

YOUR ONESURVEY  
**HOME REPORT**

---

ADDRESS

---

Glen of Rothes  
Rothes, Aberlour  
AB38 7AG

PREPARED FOR

---

Nick Rogerson

INSPECTION CARRIED OUT BY:



SELLING AGENT:

**Galbraith**

HOME REPORT GENERATED BY:



# Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Allied Surveyors Scotland Ltd	09/08/2024
Mortgage Certificate	Final	Allied Surveyors Scotland Ltd	09/08/2024
Property Questionnaire	Final	Mr. Nick Rogerson	05/08/2024
EPC	FileUploaded	Allied Surveyors Scotland Ltd	13/08/2024

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories being rated from 1 to 3.



# Single Survey

Survey report on:

<b>Customer</b>	Mr. Nick Rogerson
<b>Selling address</b>	Glen of Rothes Rothes, Aberlour AB38 7AG
<b>Date of Inspection</b>	25/07/2024
<b>Prepared by</b>	Angus F Gunn BSc MRICS, BSc (Hons) MRICS Allied Surveyors Scotland Ltd

# SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.



- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## **PART 2 – DESCRIPTION OF THE REPORT**

### **2.1 THE SERVICE**

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### **2.2 THE INSPECTION**

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### **2.3 THE REPORT**

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a detached Country House with a Bothy and range of outbuildings and grounds extending to some 24 acres or thereby.
Accommodation	Ground Floor - Porch, Inner Vestibule, Reception/Dining Hall, Drawing Room, Kitchen/Diningroom, Morning Room, 3 Bedrooms, Study, Utility, Bathroom, 2 Showerrooms, Boot Room, Boiler, Store, 2 Rear Halls both with Porch additions off. First Floor - Landing/Hallway, 4 Bedrooms, Bathroom, Store.
Gross internal floor area (m2)	Approx 480 m2.
Neighbourhood and location	The property is situated in rural (mixed farm and woodland) surroundings approximately 2 miles to the North of Rothes and some 8 miles to the South of Elgin where all major facilities/amenities are available.
Age	Circa. 124 years.
Weather	Dry and bright. The report should be read in context of these weather conditions.
Chimney stacks	Stone built, pointed or rendered and having cement or lead flashings. <b><i>Visually inspected with the aid of binoculars where required.</i></b>

<p>Roofing including roof space</p>	<p>The roof structures are of pitched, hipped design, incorporating dormer projections and comprise timber rafters clad with slates on timber sarking.</p> <p>The dormer projections have flat roofs clad with a mixture of copper, fibreglass, lead or rubber.</p> <p>Roof valleys are formed in either lead or zinc.</p> <p>Roof spaces were inspected above both the single storey rear wings but were limited to head and shoulders from the ceiling hatches only.</p> <p>A partial inspection of the roof space over the Kitchen/Dining area and Sittingroom was possible from a hatch in the first floor Store. A partial inspection of the roof space from a hatch off the first floor landing area was also possible.</p> <p>Insulation has been installed where seen within the roof spaces.</p> <p><b><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></b></p> <p>No inspection of the flat roofs was possible.</p> <p><b><i>Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i></b></p> <p><b><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></b></p>
<p>Rainwater fittings</p>	<p>Cast iron and PVC manufacture.</p> <p><b><i>Visually inspected with the aid of binoculars where required.</i></b></p>
<p>Main walls</p>	<p>The walls are of traditional masonry construction and have been pointed externally and incorporate sub-floor ventilation.</p> <p><b><i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i></b></p>
<p>Windows, external doors and joinery</p>	<p>The windows are a mixture of timber sash and casement single glazed design or have been fitted with either internal or external secondary double glazing. In addition, there are also some timber sealed unit double glazed windows. Outer doors are of solid timber or timber double glazed design.</p> <p>Fascias are formed in softwood.</p> <p><b><i>Internal and external doors were opened and closed where keys were available.</i></b></p> <p><b><i>Random windows were opened and closed where possible.</i></b></p> <p><b><i>Doors and windows were not forced open.</i></b></p>
<p>External decorations</p>	<p>External woodwork has been painted or stained.</p> <p><b><i>Visually inspected.</i></b></p>

<p>Conservatories / porches</p>	<p>There is a timber double glazed front Porch.</p> <p>The rear Porch projections would appear to be of rendered brickwork contained under pitched, slate roofs.</p> <p><b>Visually inspected.</b></p>
<p>Communal areas</p>	<p>None.</p>
<p>Garages and permanent outbuildings</p>	<p>Situated to the rear of the House are a substantial range of outbuildings to include the following more significant structures:-</p> <p>(1) Bothy</p> <p>Rendered stone and block walls with a pitched, slate roof; timber single glazing; concrete floor and electric heating. The accommodation includes a Hallway, 3 Rooms, Kitchen and Bathroom and a gross internal area of 64 m2.</p> <p>(2) Stables</p> <p>L-shaped timber built Stables with a shallow pitch onduline sheet clad roof. There are 3 Boxes, Tack Room and a Store.</p> <p>(3) Barn</p> <p>Modern steel portal framed Barn clad with profiled metal sheeting with part open to the front and the other section having sliding doors.</p> <p>(4) Steading building</p> <p>Stone built with slate and profiled metal roof coverings, split into 2 sections.</p> <p>(5) Garage</p> <p>Double car block built Garage with asbestos tiled roof and attached to the Steading building.</p> <p>(6) Workshp/Store</p> <p>Stone and timber built with a profiled corrugated iron sheet clad roof.</p> <p>(7) Garage</p> <p>Poured concrete and timber built with a pitched corrugated asbestos sheet clad roof.</p> <p>In addition, there are a range of further smaller outbuildings of stone, timber and corrugated iron construction.</p> <p><b>Visually inspected.</b></p>
<p>Outside areas and boundaries</p>	<p>It is understood that Glen of Rothes House sits in policies extending to 24 acres or thereby to include immediate garden grounds, a Riding Arena, fields/paddocks, ponds and woodland. The grounds are bounded by a mixture of fencing and a Burn. It should be noted that only the immediate garden grounds and those able to be seen from the house area, driveway and public roads have been seen. Not all of the boundaries have, therefore, been inspected.</p> <p><b>Visually inspected.</b></p>

Ceilings	<p>These are either of lath and plaster or have been plasterboard lined.</p> <p><b>Visually inspected from floor level.</b></p>
Internal walls	<p>These are either of lath and plaster, plasterboard lined or are plastered on the hard.</p> <p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p>
Floors including sub floors	<p>Suspended timber and solid concrete ground floors and a timber upper. The inspection of the flooring was restricted due to fitted floor coverings and there was no inspection possible of the sub-floor area.</p> <p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p>
Internal joinery and kitchen fittings	<p>Skirtings/architraves are formed in softwood. Doors are of timber glazed or panel design. The Kitchen comprises a range of modern units together with integral electric appliances.</p> <p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p>
Chimney breasts and fireplaces	<p>There are stoves in the Reception/Dining Hall, Morning Room and Kitchen/Dining Area. There are fireplaces in the Drawing Room and a couple of the Bedrooms.</p> <p><b>Visually inspected. No testing of the flues or fittings was carried out.</b></p>
Internal decorations	<p>Walls and ceilings have been painted or papered. Joinery has been painted.</p> <p><b>Visually inspected.</b></p>
Cellars	<p>None.</p>
Electricity	<p>Mains supply.</p> <p>Distribution wiring, where seen, is formed in PVC sheathed cable with the power points being of the modern square pin 13 amp type.</p> <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</b></p> <p><b>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</b></p>
Gas	<p>None.</p>

<p>Water, plumbing and bathroom fittings</p>	<p>Understood to be a private supply, the details of which are unknown.</p> <p>Distribution pipework, where seen, is formed in copper together with uPVC and lead soil and waste pipes.</p> <p>Sanitary fittings are of mixed origin/age and style.</p> <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p>
<p>Heating and hot water</p>	<p>An oil fired boiler serves a series of radiators at both ground and first floor level and also heats the hot water via a cylinder located in the Utility. The oil storage tank can be found within a stone and corrugated iron outbuilding.</p> <p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p>
<p>Drainage</p>	<p>Drainage is assumed to be water borne to a private septic tank located within the garden grounds. The location of the tank and soakaway is unknown.</p> <p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p>
<p>Fire, smoke and burglar alarms</p>	<p>Smoke and heat detectors have been installed.</p> <p><b>Visually inspected.</b></p> <p><b>No test whatsoever were carried out to any systems or appliances.</b></p> <p><b>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</b></p> <p><b>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</b></p> <p><b>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</b></p>



<p>Any additional limits to inspection</p>	<p>There were floor coverings throughout which restricted the inspection of the flooring.</p> <p>We have not inspected the woodwork or other parts of the structure which were covered, unexposed or inaccessible and are, therefore, unable to report that such parts of the property are free from rot, beetle or other such defects.</p> <p>No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns, then they should ask for a specialist to undertake appropriate tests. Asbestos is not harmful unless fibres are released into the air.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter to walls, ceilings and flooring where considered appropriate.</p> <p>The services, electrical circuits, plumbing installation, heating and drainage systems have not been specifically tested.</p> <p>We do not carry out an inspection for Japanese Knotweed, which is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. We have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists, removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
--	--

## Sectional Diagram showing elements of a typical house





Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:


Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Structural movement	
Repair category:	
Notes:	There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.


Dampness, rot and infestation	
Repair category:	
Notes:	<p>Evidence of dampness was recorded to wall linings adjacent to several of the fireplaces. Dampness was also recorded in wall linings in the Utility wing and in the rear Porches. Timber decay was noted to woodwork in the front Porch. Evidence of woodworm was noted to roof timbers.</p> <p>In a property of this age and type it is possible that there may be defects which are presently concealed by floor coverings, plasterwork and in areas which are presently inaccessible.</p> <p>It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects and thereafter implement all necessary remedial works under cover of long term guarantee.</p>

Chimney stacks	
Repair category:	
Notes:	<p>The rendered stack on the rear wing is in a poor state of repair and requires immediate attention. Defective mortarwork was noted elsewhere and maintenance works are necessary.</p> <p>You should ensure that all redundant flues are capped and vented.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space	
Repair category:	
Notes:	<p>There are a number of displaced and damaged slates and corrosion was evident to several of the roof valleys. Flat roof coverings will have a limited lifespan and can fail without warning.</p> <p>Further advice on the condition of the roof coverings should be sought from a roofing contractor and all necessary repairs carried out.</p> <p>It was noted that several of the roof valleys and flat roof coverings have already been replaced in relatively recent years and ongoing maintenance and renewal should be anticipated to the remainder.</p> <p>The roof is of a complex design and all junctions/valleys are potential weak points. A regular repair and maintenance programme should therefore be envisaged and it would be prudent to have an annual inspection carried out.</p> <p>There is evidence of woodworm to roof timbers (see dampness section).</p>

Rainwater fittings	
Repair category:	
Notes:	There is evidence of corrosion and vegetation growth. Downpipes should all be connected to soakaways.

Main walls	
Repair category:	
Notes:	<p>The main outer walls of the property generally appeared in fair order consistent with age.</p> <p>Mastic seals between the window frames and stonework should be renewed during the course of routine maintenance.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

## Windows, external doors and joinery

Repair category:	2
Notes:	<p>There are areas of decay and rot to window frames and external joinery. Seals to some of the double glazed windows have failed causing condensation between the panes.</p> <p>Windows can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance/repair will be required as part of an ongoing maintenance programme.</p>

## External decorations

Repair category:	1
Notes:	The external decorations are generally in fair order. Regular repainting will be required if these areas are to be maintained in satisfactory condition.

## Conservatories / porches


Repair category:	3
Notes:	Evidence of timber decay noted along with dampness and remedial repairs are necessary.

## Communal areas


Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


## Garages and permanent outbuildings

Repair category:	
Notes:	<p>The older outbuildings, in particular, require maintenance/repair and several of the smaller buildings due to their age and nature of construction would benefit from being removed in their entirety. Care, should however, be taken as asbestos materials were noted to be present. The informed opinion is that these materials offer no hazard to health whilst they remain intact and undisturbed. Specialist advice and appropriate precautions should be taken prior to disturbing any material which could potentially contain asbestos fibres which may be hazardous to health if released into the atmosphere.</p> <p>The Bothy requires complete renovation if it is to be utilised for habitable purposes.</p>


## Outside areas and boundaries

Repair category:	
Notes:	<p>The boundaries where seen, appear reasonably well defined. Regular maintenance will be required to the boundaries. You should verify with your conveyancer the extent of the boundaries attaching to the property.</p>

## Ceilings

Repair category:	
Notes:	<p>The ceilings are of lath and plaster construction and there is evidence of cracking and unevenness. Repairs should be anticipated.</p> <p>There is also evidence of dampness to the ceiling linings in the Store Room in the Utility wing.</p>

## Internal walls

Repair category:	
Notes:	<p>Dampness noted to wall linings adjacent to several of the fireplaces and in the Utility wing (see dampness section).</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors	
Repair category:	1
Notes:	There was no visible evidence to suggest any significant defects to the flooring, however, my inspection was restricted due to floor coverings and furnishings. No access was possible to the sub-floor area and no comment can be made on the condition of the timbers therein.

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	The internal joinery is showing some signs of wear and tear and upgrading during routine decoration is thought necessary.  The kitchen fittings are generally in adequate condition for their age and type.

Chimney breasts and fireplaces	
Repair category:	2
Notes:	It is assumed that the stove has been installed in accordance with the manufacturer's recommendations for fluing and ventilation and always utilises the correct type of fuel. The appliance has not been tested and is therefore presumed to be in good working order. The flue should be regularly swept.  Due to the concealed nature of flues within chimneys, we are not able to assess the internal condition of enclosed flues. Older flues in particular are susceptible to heat related damage. Flues with sealed up fireplace openings should be vented and a suitable terminal fitted to the chimney pots to prevent rain from entering the flue and causing dampness inside the house. Flues to open fireplaces should be swept at least once a year if they are in use and any gas appliances, such as fires and boilers, which are connected to traditional flues should be serviced at least once a year to make sure they are safe and that the flues are working correctly.  It is understood that fireplaces may not have been used for some time. We would advise a precautionary check of chimney breasts/flues prior to use.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal decorations	
Repair category:	1
Notes:	The property appears in fair decorative condition consistent with age (although it is recognised that on taking occupancy home owners may consider redecoration).

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	3
Notes:	<p>The electrical installation is of mixed age and includes a number of older sections. It will be necessary to have the installation checked by a suitably qualified electrician and upgraded as necessary.</p> <p>It should be noted that only the most recently built or rewired properties will have installations which fully comply with present IET regulations. It is a recommendation that electrical installations be tested at least every 10 years, or upon a change of ownership. If the installation has not been tested within the last 10 years and a satisfactory Test Certificate obtained, then it is advised that an NICEIC qualified electrician undertake a full check of the installation prior to concluding Missives and any necessary upgrading works be undertaken in accordance with their recommendations.</p>

Gas	
Repair category:	
Notes:	Not applicable.



Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

## Water, plumbing and bathroom fittings

Repair category:

3

Notes:

Seals around the bath/shower areas are frequently troublesome and require regular maintenance. Failure to maintain seals can result in dampness and decay to adjoining and underlying areas. No inspection has been possible to the flooring or the timbers beneath, which are assumed to be in reasonable condition.

There is a private water supply serving the property. It is assumed that the flow has been continuous for at least 10 years and the water is fit for human consumption. It would be prudent to carry out checks.

There is the possibility of old style sections in concealed areas and it would be prudent to budget for upgrading in conjunction with other modernisation works.

## Heating and hot water

Repair category:

2

Notes:

There is evidence of staining/leakage at radiator valves and a full check of the heating installation is considered necessary.

It has been assumed that the boiler/heating system has been regularly serviced and is in a good working order. If there is no current service certificate, then a Heating Engineer should be instructed to check and test the system to ensure it is in good working order as a condition of any offer.

## Drainage

Repair category:

2

Notes:

No surface indication of any defect noted.

As this is a private drainage system, prospective purchasers should satisfy themselves that the system is in good working order prior to making an offer.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

<b>Structural movement</b>	1
<b>Dampness, rot and infestation</b>	3
<b>Chimney stacks</b>	3
<b>Roofing including roof space</b>	3
<b>Rainwater fittings</b>	3
<b>Main walls</b>	1
<b>Windows, external doors and joinery</b>	2
<b>External decorations</b>	1
<b>Conservatories / porches</b>	3
Communal areas	
<b>Garages and permanent outbuildings</b>	3
<b>Outside areas and boundaries</b>	1
<b>Ceilings</b>	2
<b>Internal walls</b>	3
<b>Floors including sub-floors</b>	1
<b>Internal joinery and kitchen fittings</b>	2
<b>Chimney breasts and fireplaces</b>	2
<b>Internal decorations</b>	1
Cellars	
<b>Electricity</b>	3
Gas	
<b>Water, plumbing and bathroom fittings</b>	3
<b>Heating and hot water</b>	2
<b>Drainage</b>	2

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

### 3. ACCESSIBILITY INFORMATION

#### Guidance Notes on Accessibility Information

**Three steps or fewer to a main entrance door of the property:** In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

**Unrestricted parking within 25 metres:** For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground & First
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

It has been assumed that Scottish Ownership exists and that there are no onerous conditions or restrictive servitudes contained in the Title.

Drainage is to a private drainage system and, in this connection, my valuation assumes that the private drainage arrangements meets with and complies with Statutory Legislation, as outlined by the Scottish Environment Protection Agency. There is now a requirement to register septic tanks with SEPA. It is assumed that the septic tank serving the subjects has been, or in the case of a sale, will be registered as part of the normal conveyancing process.

It is assumed that appropriate legal rights exist for the use, maintenance and repair of the private water supply, to include all necessary servitude rights. That the private water supply is adequate in all respects, and that a recent certificate confirming satisfactory testing of the water quality is available. Furthermore, in the event of shared use, that repair/maintenance responsibilities are on an equitable share basis.

There is understood to be a right of access over part of the driveway in favour of Maypark, a neighbouring property.

The insurance figure quoted is for the house only and specifically excludes the outbuildings. Further advice from a Buildings Surveyor should be sought if you wish to include the outbuildings.

The subjects will form a suitable security for mortgage purposes subject to individual lenders guidelines.

Where category 2 items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

### Estimated re-instatement cost (£) for insurance purposes

2,750,000

The property should be insured for a sum of no less than Two Million Seven Hundred and Fifty Thousand Pounds.

### Valuation (£) and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £650,000 (Six Hundred and Fifty Thousand Pounds).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

### Report author:

Angus F Gunn BSc MRICS, BSc (Hons) MRICS

<b>Company name:</b>	Allied Surveyors Scotland Ltd
<b>Address:</b>	35 Moray Street Elgin IV30 1JH
<b>Signed:</b>	Electronically Signed: 264450-237819A1-A304
<b>Date of report:</b>	09/08/2024

P A R T 2 .

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.





**Mortgage Valuation Report**

Property:	Glen of Rothes Rothes, Aberlour AB38 7AG	Client: Mr. Nick Rogerson Tenure: Ownership
Date of Inspection:	25/07/2024	Reference: AFG/DEB/240369

*This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

<b>1.0</b>	<b>LOCATION</b>						
The property is situated in rural (mixed farm and woodland) surroundings approximately 2 miles to the North of Rothes and some 8 miles to the South of Elgin where all major facilities/amenities are available.							
<b>2.0</b>	<b>DESCRIPTION</b>			<b>2.1 Age:</b>	Circa. 124 years.		
The subjects comprise a detached Country House with a Bothy and range of outbuildings and grounds extending to some 24 acres or thereby.							
<b>3.0</b>	<b>CONSTRUCTION</b>						
Stone walls. Pitched, slate and flat fibreglass, lead, copper and rubber roofs. Timber and concrete floors. Timber single, secondary and double glazed windows.							
<b>4.0</b>	<b>ACCOMMODATION</b>						
Ground Floor - Porch, Inner Vestibule, Reception/Dining Hall, Drawing Room, Kitchen/Diningroom, Morning Room, 3 Bedrooms, Study, Utility, Bathroom, 2 Showerrooms, Boot Room, Boiler, Store, 2 Rear Halls both with Porch additions off.  First Floor - Landing/Hallway, 4 Bedrooms, Bathroom, Store.							
<b>5.0</b>	<b>SERVICES (No tests have been applied to any of the services)</b>						
<b>Water:</b>	Private	<b>Electricity:</b>	Mains	<b>Gas:</b>	None	<b>Drainage:</b>	Septic tank
<b>Central Heating:</b>	Oil fired boiler serving radiators.						
<b>6.0</b>	<b>OUTBUILDINGS</b>						
<b>Garage:</b>	Double car block/asbestos built Garage.						
<b>Others:</b>	Barn, Stables, Steading, Bothy, Garage, Workshop and others.						

<b>7.0</b>	<b>GENERAL CONDITION</b> - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>
------------	--

The subjects were seen to be in a condition consistent with its age and type of construction but would benefit from a degree of repair/maintenance along with some upgrading/refurbishment.

<b>8.0</b>	<b>ESSENTIAL REPAIR WORK</b> <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>
------------	--

- (1) Timber specialist to treat dampness, woodworm and decay.
- (2) Building Contractor to repair defective chimney stacks.
- (3) Roofer to overhaul roof coverings and rainwater fittings.

The figure quoted in 8.1 is for mortgage purposes only.

<b>8.1 Retention recommended:</b>	N/A
-----------------------------------	-----

<b>9.0</b>	<b>ROADS &amp; FOOTPATHS</b>
------------	------------------------------

Adopted by the Local Authority.

<b>10.0</b>	<b>BUILDINGS INSURANCE (£):</b>	2,750,000	<b>GROSS EXTERNAL FLOOR AREA</b>	600	<b>Square metres</b>
-------------	---------------------------------	-----------	----------------------------------	-----	----------------------

*This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.*

<b>11.0</b>	<b>GENERAL REMARKS</b>
-------------	------------------------

It has been assumed that Scottish Ownership exists and that there are no onerous conditions or restrictive servitudes contained in the Title.

Drainage is to a private drainage system and, in this connection, my valuation assumes that the private drainage arrangements meets with and complies with Statutory Legislation, as outlined by the Scottish Environment Protection Agency. There is now a requirement to register septic tanks with SEPA. It is assumed that the septic tank serving the subjects has been, or in the case of a sale, will be registered as part of the normal conveyancing process.

It is assumed that appropriate legal rights exist for the use, maintenance and repair of the private water supply, to include all necessary servitude rights. That the private water supply is adequate in all respects, and that a recent certificate confirming satisfactory testing of the water quality is available. Furthermore, in the event of shared use, that repair/maintenance responsibilities are on an equitable share basis.

There is understood to be a right of access over part of the driveway in favour of Maypark, a neighbouring property.

The insurance figure quoted is for the house only and specifically excludes the outbuildings. Further advice from a Buildings Surveyor should be sought if you wish to include the outbuildings.

The subjects will form a suitable security for mortgage purposes subject to individual lenders guidelines.

Where category 2 items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.



<b>12.0</b>	<b>VALUATION</b> <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
<b>12.1</b>	<b>Market Value in present condition (£):</b>	<b>650,000</b>	(Six Hundred and Fifty Thousand Pounds)
<b>12.2</b>	<b>Market Value on completion of essential works (£):</b>	<b>N/A</b>	
<b>12.3</b>	<b>Suitable security for normal mortgage purposes?</b>	Yes	
<b>12.4</b>	<b>Date of Valuation:</b>	25/07/2024	
<b>Signature:</b>		Electronically Signed: 264450-237819A1-A304	
<b>Surveyor:</b>	Angus F Gunn BSc MRICS	BSc (Hons) MRICS	<b>Date:</b> 09/08/2024
<b>Allied Surveyors Scotland Ltd</b>			
<b>Office:</b>	35 Moray Street Elgin IV30 1JH	Tel: 01343 547 481 Fax: email: <a href="mailto:elgin@alliedsurveyorsscotland.com">elgin@alliedsurveyorsscotland.com</a>	

PART 3.

# ENERGY REPORT

---

A report on the energy efficiency of the property.



# energy report

energy report on:

<b>Property address</b>	Glen of Rothes Rothes, Aberlour AB38 7AG
-------------------------	--

<b>Customer</b>	Mr. Nick Rogerson
-----------------	-------------------

<b>Customer address</b>	Glen of Rothes Rothes, Aberlour AB38 7AG
-------------------------	--

<b>Prepared by</b>	Angus F Gunn BSc MRICS, BSc (Hons) MRICS Allied Surveyors Scotland Ltd
--------------------	---

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

**GLEN OF ROTHES, ROTHES, ABERLOUR, AB38 7AG**

**Dwelling type:** Detached house  
**Date of assessment:** 25 July 2024  
**Date of certificate:** 13 August 2024  
**Total floor area:** 457 m<sup>2</sup>  
**Primary Energy Indicator:** 318 kWh/m<sup>2</sup>/year


**Reference number:** 7314-8523-1100-0855-8222  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, oil

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£29,565</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£14,640</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

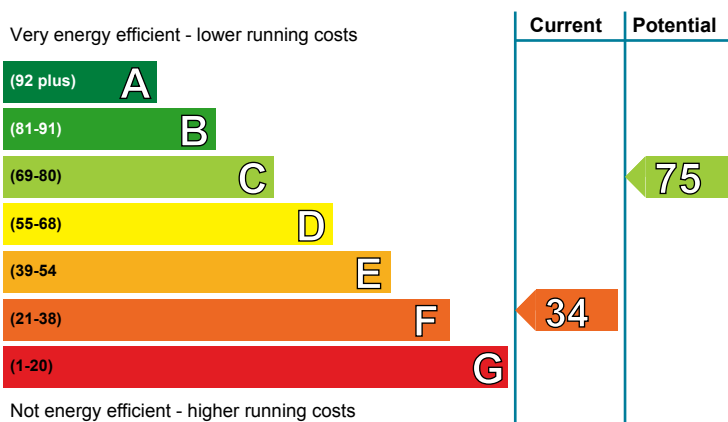


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (34)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

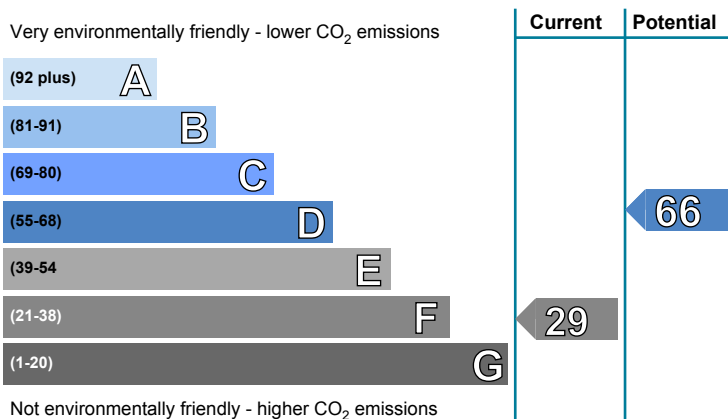

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (29)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£5361.00
2 Internal or external wall insulation	£4,000 - £14,000	£5154.00
3 Floor insulation (suspended floor)	£800 - £1,200	£2442.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 100 mm loft insulation Pitched, 400+ mm loft insulation Roof room(s), no insulation (assumed)	★★★★☆☆ ★★★★★★ ★☆☆☆☆	★★★★☆☆ ★★★★★★ ★☆☆☆☆
Floor	Suspended, no insulation (assumed) Solid, no insulation (assumed)	— —	— —
Windows	Mostly secondary glazing	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, oil	★★★★☆☆	★★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆☆	★★★★☆☆
Lighting	Low energy lighting in 43% of fixed outlets	★★★★☆☆	★★★★☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 83 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 38 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 22 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£27,219 over 3 years	£13,269 over 3 years	
Hot water	£831 over 3 years	£693 over 3 years	
Lighting	£1,515 over 3 years	£963 over 3 years	
<b>Totals</b>	<b>£29,565</b>	<b>£14,925</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£1787	E 45	F 38
2 Internal or external wall insulation	£4,000 - £14,000	£1718	D 57	E 48
3 Floor insulation (suspended floor)	£800 - £1,200	£814	D 63	E 54
4 Draughtproofing	£80 - £120	£71	D 63	D 55
5 Low energy lighting for all fixed outlets	£140	£157	D 64	D 55
6 Replace boiler with new condensing boiler	£2,200 - £3,000	£333	D 66	D 58
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£481	C 69	D 61
8 Wind turbine	£15,000 - £25,000	£1135	C 75	D 66

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

### 2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 4 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

### 5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 6 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 8 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	101,927	(1,063)	N/A	(17,744)
Water heating (kWh per year)	3,246			

## Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.



## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Angus Gunn
Assessor membership number:	EES/008267
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	209 High Street Elgin IV30 1DJ
Phone number:	01343 547481
Email address:	<a href="mailto:elgin@alliedsurveyors.com">elgin@alliedsurveyors.com</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

**Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



## Property Questionnaire

Property Address

Glen of Rothes  
 Rothes, Aberlour  
 AB38 7AG

Seller(s)

Gresham House Forest Growth & Sustainability LP

Completion date of property questionnaire

05/08/2024

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<p><b>How long have you owned the property?</b></p> <p>3 Years</p>
<b>2.</b>	<b>Council tax</b>
	<p><b>Which Council Tax band is your property in? (Please circle)</b></p> <p><input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input checked="" type="checkbox"/> G <input type="checkbox"/> H</p>
<b>3.</b>	<b>Parking</b>
	<p><b>What are the arrangements for parking at your property?</b></p> <p><b>(Please tick all that apply)</b></p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input checked="" type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify):</p>

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>6.</b>	<b>Alterations/additions/extensions</b>	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	
<b>7.</b>	<b>Central heating</b>	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial

# property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).  <i>Oil</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?  <i>Unknown</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
<b>9.</b>	<b>Issues that may have affected your property</b>	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
<b>10.</b>	<b>Services</b>	

# property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	N	
	Water mains or private water supply	Y	
	Electricity	Y	
	Mains drainage	N	
	Telephone	Y	
	Cable TV or satellite	N	
	Broadband	Y	
b	Is there a septic tank system at your property?		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
<b>11. Responsibilities for shared or common areas</b>			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

# property questionnaire

f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)  If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>12. Charges associated with your property</b>		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
<b>13. Specialist works</b>		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	



# property questionnaire

<b>14. Guarantees</b>		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

<b>15. Boundaries</b>		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
<b>16. Notices that affect your property</b>		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

**Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s):	Nick Rogerson
Capacity:	<input type="checkbox"/> Owner <input checked="" type="checkbox"/> Legally Appointed Agent for Owner
Date:	05/08/2024