

YOUR ONESURVEY
HOME REPORT

ADDRESS

Holmes Cottage
Galston Road
Hurlford, Kilmarnock
KA1 5JD

PREPARED FOR

J Shuttleton

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Galbraith

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Kilmarnock - Allied Surveyors Scotland Ltd	26/08/2024
Mortgage Certificate	Final	Kilmarnock - Allied Surveyors Scotland Ltd	26/08/2024
Property Questionnaire	Final	Mrs. J Shuttleton	21/08/2024
EPC	FileUploaded	Kilmarnock - Allied Surveyors Scotland Ltd	26/08/2024

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	MA/0574
---------------------------	---------

Customer	Mrs. J Shuttleton
-----------------	-------------------

Selling address	Holmes Cottage Galston Road Hurlford, Kilmarnock KA1 5JD
------------------------	---

Date of Inspection	26/08/2024
---------------------------	------------

Prepared by	Nick Davis, MSc MRICS Kilmarnock - Allied Surveyors Scotland Ltd
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a detached and extended one storey and attic character farmhouse style cottage, with side sunroom projection, various size/style outbuildings, and large detached tractor shed, set on just under 4 acres of associated grounds.
Accommodation	Ground floor - entrance vestibule, hallway/stairs, lounge, sitting room, bedroom, breakfasting kitchen, sunroom, inner hallway, study/home office, utility area and shower room with WC. Upper floor - landing, two bedrooms and bathroom with WC.
Gross internal floor area (m2)	185 sq. metres approximately (including sunroom but excluding remaining outbuildings/structures).
Neighbourhood and location	The subjects are situated within a semi-rural position, set around 1 mile from the outskirts of Galston, and around 1 mile from the outskirts of Hurlford. Local amenities and facilities are available within a short drive. Main facilities are located within Kilmarnock, around 4-5 miles away. The property is set adjacent to the A71.
Age	Originally constructed around 1900, with a number of alterations and extensions assumed to have been carried out thereafter.
Weather	Dry, bright and partly overcast. Period of mixed weather prior to inspection.
Chimney stacks	In general terms and where visible, chimney stacks are formed in stone and brick design, protected at roof level by lead/similar apron flashings. No flue linings were inspected or tested. <i>Visually inspected with the aid of binoculars where required.</i>

<p>Roofing including roof space</p>	<p>The main roof is pitched, timber framed and overlaid in slate, incorporating slate lined original dormer projections to front and rear, and a felt/similar dormer projection over bathroom at front. Understandably our inspections were limited.</p> <p>Rear single storey projection is also pitched, timber framed and overlaid in slate, again, incorporating similar flashings and linings to main roof.</p> <p>Limited attic space inspection revealed the structure to be timber framed, incorporating a degree of insulation material at joist level.</p> <p>Stored items, insulation material and roof design restricted our inspection.</p> <p>From severely restricted inspection, rear projection roof space appears to be of similar style.</p> <p><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></p> <p><i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i></p> <p><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></p> <p><i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i></p>
<p>Rainwater fittings</p>	<p>Rainwater fittings are formed in a combination of parapet, cast iron and PVC components.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p>
<p>Main walls</p>	<p>The main outer walls are predominately of solid red sandstone design, pointed, incorporating decorative stone details to front.</p> <p><i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i></p>
<p>Windows, external doors and joinery</p>	<p>Windows are predominately of replacement double glazed PVC framed design.</p> <p>A small single glazed unit exists within a rear hallway pantry/recess.</p> <p>Front entrance doors are of twin PVC clad and glazed design.</p> <p>Side entrance door is a modern PVC clad unit.</p> <p><i>Internal and external doors were opened and closed where keys were available.</i></p> <p><i>Random windows were opened and closed where possible.</i></p> <p><i>Doors and windows were not forced open.</i></p>

<p>External decorations</p>	<p>Some painted external timber joinery was noted.</p> <p>Visually inspected.</p>
<p>Conservatories / porches</p>	<p>The side sunroom projection is set on a block work/stonework base, and is surmounted by a timber/PVC framed structure, with a pitched and retro fitted lightweight tile effect roof covering, lined internally with plasterboard.</p> <p>Windows and doors are of double glazed PVC framed design.</p> <p>Visually inspected.</p>
<p>Communal areas</p>	<p>No internal communal circulation areas.</p>
<p>Garages and permanent outbuildings</p>	<p>The property benefits from a number of external outbuildings and structures.</p> <p>Tractor shed outer walls are of modern steel portal framed design, with block work infills, and externally the structure is lined with profiled steel outer wall and roof sheeting.</p> <p>A large roller vehicular access door exists.</p> <p>A single storey container style structure exists, off tractor shed. Our inspections were limited.</p> <p>Thereafter a detached brick and corrugated tin wood store exists.</p> <p>A lean-to style structure exists, with slate roof and brick walls, incorporating a brick chimney stack.</p> <p>An open to air timber structure exists.</p> <p>A detached brick/corrugated asbestos cement workshop style office was noted, with plasterboard internal linings, and mezzanine level, also incorporating a small WC.</p> <p>Our inspections were naturally restricted throughout.</p> <p>Visually inspected.</p>
<p>Outside areas and boundaries</p>	<p>Again, the subjects are understood to incorporate just under 4 acres of land.</p> <p>The property is accessed via a private roadway off main public highway.</p> <p>In general terms boundaries are of a hedge, post and wire, timber, and stone/wrought iron design.</p> <p>Grounds are overlaid in extensive areas of lawn, together with gravel, tarmac and a range of insitu concrete hard standings.</p> <p>A generous sized yard area exists.</p> <p>A number of mature trees, shrubs and bushes exist.</p> <p>We have not inspected the entirety of the plot/associated ground, nor areas outwith.</p> <p>Visually inspected.</p>


<p>Ceilings</p>	<p>Ceilings are formed in a combination of lath and plaster and plasterboard, together with a number of plasterboard linings.</p> <p>Visually inspected from floor level.</p>
<p>Internal walls</p>	<p>Internal walls are predominately plasterboard lined, with a number of lath and plaster and plastered hard areas also.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
<p>Floors including sub floors</p>	<p>Flooring at ground level is formed in a combination of suspended timber and solid design, with suspended timber/similar flooring at upper level.</p> <p>All floors were overlaid in fixed coverings and no sub floor inspections were available.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
<p>Internal joinery and kitchen fittings</p>	<p>Internal joinery and door surrounds are predominately of a traditional timber design, part painted and part glazed.</p> <p>There is a timber stair leading from the ground to the upper level.</p> <p>Kitchen fittings comprise a modern range of wall and base mounted units incorporating a detached breakfast bar/island detail.</p> <p>The utility areas features base mounted units and a stainless steel sink.</p> <p>No comment can be made that internal glazing panels are of toughened or safety glass.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
<p>Chimney breasts and fireplaces</p>	<p>A decorative solid fuel style stove was noted within sitting room.</p> <p>Lounge fireplace is understood to incorporate a gas appliance.</p> <p>We have not tested or inspected appliances thereafter.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
<p>Internal decorations</p>	<p>Traditional paper, emulsion and tile finishes were noted.</p> <p>Visually inspected.</p>

Cellars	There are no cellars pertaining to the subjects.
Electricity	<p>Mains electricity supply.</p> <p>The electrical fuse box features circuit breaker fuses and where visible exposed wiring is encased in both PVC and rubber connected to 13 amp power points, some of which are lower set.</p> <p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Gas	<p>Mains gas connected. This should be confirmed.</p> <p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Water, plumbing and bathroom fittings	<p>Mains water supply.</p> <p>Plumbing where visible is of copper and PVC style.</p> <p>Sanitary fittings to the ground floor shower room incorporate a modern shower compartment, WC and wash hand basin.</p> <p>First floor bathroom features a modern bath, WC and wash hand basin.</p> <p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</i></p>
Heating and hot water	<p>Space heating and hot water is understood to be provided via wall mounted gas fired combination boiler located within the kitchen. This serves water filled radiators to the main apartments and provides domestic hot water.</p> <p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p>

<p>Drainage</p>	<p>We understand drainage is to a private septic tank, within grounds. The location of this detail should be confirmed.</p> <p><i>Drainage covers etc were not lifted.</i></p> <p><i>Neither drains nor drainage systems were tested.</i></p>
<p>Fire, smoke and burglar alarms</p>	<p>A number of ceiling mounted smoke detectors were noted.</p> <p><i>Visually inspected.</i></p> <p><i>No test whatsoever were carried out to any systems or appliances.</i></p> <p><i>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</i></p> <p><i>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</i></p> <p><i>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</i></p>

<p>Any additional limits to inspection</p>	<p>No access was gained above ceiling linings or behind fixed timber goods or sanitary ware.</p> <p>We have not tested all window/doors and associated handles to avoid excessive physical contact.</p> <p>We have not tested any elements of the electrical, heating and plumbing system and it would be prudent to do so prior to purchase.</p> <p>Due to ever changing climate conditions, it would therefore be prudent to conduct appropriate background checks with regard to potential flood risks in and around the area, by reference to SEPA flood map/similar.</p> <p>No furniture, fixtures/fittings or breakable items were moved during the course of our inspection. It would be prudent to check behind/under prior to purchase.</p> <p>Potential purchasers should satisfy themselves with regard to Fire Safety regulations and fire escape arrangements pertaining to the subject property, prior to purchase.</p> <p>We have not walked the entirety of the plot or inspected all boundaries. This should be done so prior to purchase.</p> <p>Severely restricted outbuilding inspections were available.</p> <p><i>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</i></p> <p><i>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</i></p>
--	--

Sectional Diagram showing elements of a typical house

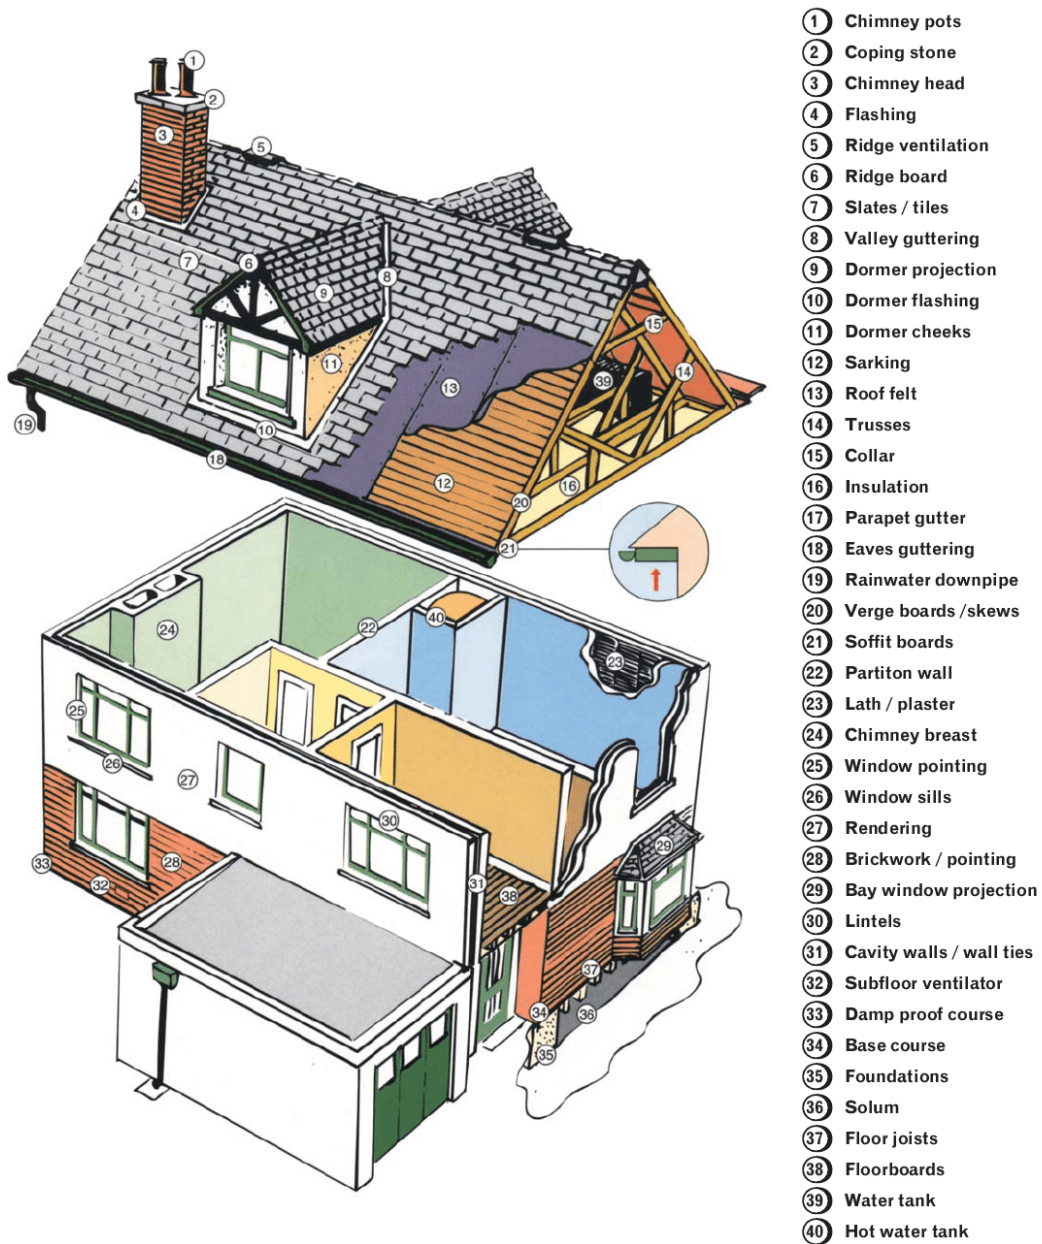

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is evidence of settlement/ movement, reflected in the form of some external masonry distortion, together with off plumb window/door arrangements and runs and dips to flooring. On the basis of a single inspection, and with regard to age and character, points noted would appear to be longstanding.

Dampness, rot and infestation	
Repair category:	2
Notes:	<p>Some above average moisture readings were obtained to lower wall linings at ground floor level.</p> <p>Localised positive moisture readings were obtained within rear single storey office/study area. Investigate and repair as necessary.</p> <p>Above average readings were obtained around half landing window and wall areas.</p> <p>Thereafter, a number of scattered woodworm bore holes were noted to joinery items, predominately within first floor cupboards and under stair store cupboard. In the absence of valid guarantees for past treatments, further advice should be obtained via a reputable timber and damp specialist.</p> <p>Scattered woodworm bore holes also appear to exist within main attic space.</p> <p>In light of the above points, it would be prudent to obtain further advice via a reputable timber and damp specialist.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney stacks	
Repair category:	2
Notes:	<p>A degree of weathering and wear and tear was noted to chimney stacks, together with pockets of frost action.</p> <p>Slight lean and evidence of past repairs noted to rearmost chimney stack. Repairs are required.</p> <p>Thereafter, routine maintenance expenditures should be anticipated, increasing over time.</p>

Roofing including roof space	
Repair category:	2
Notes:	<p>Roof slating appears to have been mainly adequately maintained with regard to age and character, however, a number of loose and misaligned slates were noted to main roof covering, together with some slipped slates at rear single storey projection.</p> <p>A degree of maintenance is required.</p> <p>Flat roof coverings have a more limited life span.</p> <p>Valley details will require regular maintenance, naturally increasing over time.</p>

Rainwater fittings	
Repair category:	2
Notes:	<p>Some open and worn mortar joints were noted to parapet details, from limited ground floor inspection, together with a degree of general wear and tear thereafter. Rainwater goods and fittings should be checked during periods of adverse weather to confirm performance, and repaired if necessary thereafter.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls

Repair category:

2

Notes:

Generally neat and tidy outer wall finishes noted, within a degree of past settlement noted, together with some worn stonework and mortar joints.

It is appreciated that pointing has been carried out in recent times.

Routine maintenance expenditures should be anticipated.

Windows, external doors and joinery

Repair category:

2

Notes:

Mid and mix age window and door units noted, some of which display a degree of wear and tear to handles and operating mechanisms.

Some slightly misaligned internal decorative glazing insert details were noted.

Routine maintenance expenditures associated with double glazed window panels and opening mechanisms should be anticipated.

Again an older style single glazed window unit was noted displaying high levels of wear and tear. Ongoing maintenance/repair will be required.

A small number of misted window units were noted within the property which may require replacement.

External decorations

Repair category:

1

Notes:

The property was found to be in generally good external decorative order.

Redecoration will be required from time to time.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories / porches

Repair category:	2
Notes:	<p>It is appreciated that the roof structure has been overlaid with modern materials in recent times.</p> <p>Thereafter a degree of general wear and tear was noted to the external structure.</p> <p>A misted window unit was noted, with a degree of wear and tear thereafter.</p>

Communal areas

Repair category:	
Notes:	No internal communal circulation areas.

Garages and permanent outbuildings

Repair category:	3
Notes:	<p>Mixed age/style structures were noted.</p> <p>The large tractor shed displays a degree of wear and tear and localised impact damage to steel linings. The attached metal storage unit displays defect and evidence of water ingress. Therefore repairs are required.</p> <p>The detached workshop/office structure displays high levels of wear and tear, and in addition decay and positive moisture readings were noted and obtained to roof joists.</p> <p>The roof structure displays high levels of wear and tear and localised damage. Repairs are required as a priority. Asbestos components should only be handled by licensed contractors.</p> <p>Again positive moisture readings were obtained internally. Advice should be obtained via a reputable timber and damp specialist.</p> <p>An open to air structure was noted, which has suffered storm damage in recent times. Comprehensive repair is required.</p> <p>Thereafter structures display high levels of wear and tear to external fabric, and moisture readings were obtained throughout.</p> <p>Some outbuildings are of nominal value in present condition.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries	
Repair category:	2
Notes:	<p>Grounds were found to be in mixed style/condition, with neat and tidy grounds to front and side.</p> <p>Frost damage was noted to some hard standings.</p> <p>Decay noted to a timber free standing open to air structure, which requires repair.</p> <p>General wear and tear noted to boundaries and hard standings thereafter.</p> <p>Routine maintenance expenditures should be anticipated.</p> <p>Some surface water was noted, and it would be prudent to confirm that drainage arrangements are satisfactory.</p> <p>Some field ditches were noted, however, we have not inspected these areas. Potential purchasers should conduct background enquiries in this regard.</p> <p>Mature trees will require professional treatment from time to time.</p> <p>Hedgerow will require to be tended annually.</p> <p>Again, we have not inspected the entirety of the plot/associated grounds.</p>

Ceilings	
Repair category:	1
Notes:	<p>General plaster wear and tear and localised cracking/misalignment noted, predominately to cornice details. Plaster work of this age and style can become brittle when disturbed, and a degree of selective re-plastering will be required.</p>

Internal walls	
Repair category:	2
Notes:	<p>General plaster wear and tear noted. Again plaster work of this age and style can become brittle when disturbed.</p> <p>Localised re-plastering will be required.</p> <p>Again positive moisture readings were predominately obtained within rear single storey study/home office area, and therefore re-plastering will be required upon eradication of dampness identified.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors

Repair category:	1
Notes:	Weight testing of flooring at random at various points throughout the property proved it to be generally level and well supported.

Internal joinery and kitchen fittings

Repair category:	1
Notes:	<p>Traditional joinery items were mainly noted, some of which display a degree of wear and tear, together with a small amount of animal scratchings.</p> <p>Modern kitchen fittings were noted.</p> <p>Again some scattered woodworm bore holes were evident.</p> <p>Utility area displays a degree of wear and tear to fittings.</p>

Chimney breasts and fireplaces

Repair category:	1
Notes:	<p>Mid range moisture readings were obtained around chimney/fireplace areas. Monitor over time.</p> <p>It should be confirmed that appliances were installed in accordance with manufacturers guidelines.</p>

Internal decorations

Repair category:	1
Notes:	The property was found to be in generally good internal decorative order, however, some selective re-plastering will be required.

Cellars

Repair category:	
Notes:	There are no cellars pertaining to the subjects.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity	
Repair category:	2
Notes:	<p>Mixed age and style electrical installation noted, however, it is appreciated that circuit breaker arrangements exist.</p> <p>Some loose wiring and fuses were noted within main electrical cupboard.</p> <p>Old style wiring noted to some light fittings.</p> <p>It would be prudent to obtain precautionary advice via a reputable and qualified electrician.</p>

Gas	
Repair category:	1
Notes:	<p>It should be confirmed that the installation is mains connected.</p> <p>No evidence is available to confirm recent testing or servicing. Failure to test the service regularly increases safety risks. Ideally a current test certificate should be made available.</p>

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	<p>Modern sanitary fittings noted to ground floor shower room and first floor bathroom, within the limitations of our inspection.</p> <p>We have not tested any elements of the system and it would be prudent to do so prior to purchase.</p>

Heating and hot water	
Repair category:	1
Notes:	<p>Modern central heating boiler, which we understand is under an annual service plan.</p> <p>The system will require annual servicing.</p> <p>Any supporting documentation should be made available.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair category:	1
Notes:	It should be confirmed that all necessary SEPA/similar consents exist. The system will require maintenance, naturally increasing over time.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	2
Communal areas	
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	1
Internal walls	2
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>The property and surrounding plot have been subject to various alterations and extensions to form current layout and footprint. It should therefore be confirmed that all necessary Local Authority permissions and consents were obtained at the relevant dates.</p> <p>A side sunroom/conservatory projection has been formed at some stage.</p> <p>Furthermore a dormer projection has been formed at roof level over bathroom.</p> <p>It should be confirmed that necessary Local Authority permissions, warrants and consents were obtained at the appropriate dates.</p> <p>Confirm the exact extent of boundaries, acreage and rights of way by reference to Title Deeds.</p> <p>Potential purchasers should conduct their own enquiries with regard to usage and permissions pertaining to tractor shed and external store/outbuildings.</p> <p>Enquiries should be made with regard to drainage arrangements and any flood events that may historically have affected surrounding land. It should be confirmed that building and contents insurance can be obtained on standard terms.</p> <p>It should be confirmed that necessary permissions were obtained for the construction of a large tractor shed.</p> <p>The subjects are situated within an area of known past coal mining activity, and as such a Coal Mining Report should be obtained prior to purchase.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>820,000 (guide figure for basic reconstruction). Given the size, number and style of outbuilding/structures, it would be prudent to obtain specialist advice in the regard to ensure comprehensive coverage exists.</p> <p>Eight Hundred and Twenty Thousand Pounds.</p>	
Valuation (£) and market comments	
<p>430,000</p> <p>Taking current market conditions into account together with points detailed within our report we are of the opinion that the current market value of the heritable property is fairly stated in the capital sum of FOUR HUNDRED AND THIRTY THOUSAND POUNDS.</p>	
Report author:	Nick Davis, MSc MRICS
Company name:	Kilmarnock - Allied Surveyors Scotland Ltd

Address:	91 John Finnie Street Kilmarnock KA1 1BG
Signed:	Electronically Signed: 267237-7e8020c8-175a
Date of report:	26/08/2024

PART 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	Holmes Cottage Galston Road Hurlford, Kilmarnock KA1 5JD	Client: Mrs. J Shuttleton Tenure: Ownership
Date of Inspection:	26/08/2024	Reference: MA/0574

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are situated within a semi-rural position, set around 1 mile from the outskirts of Galston, and around 1 mile from the outskirts of Hurlford.

Local amenities and facilities are available within a short drive. Main facilities are located within Kilmarnock, around 4-5 miles away.

The property is set adjacent to the A71.

2.0	DESCRIPTION	2.1 Age:	Originally constructed around 1900, with a number of alterations and extensions assumed to have been carried out thereafter.
------------	--------------------	-----------------	--

The subjects comprise a detached and extended one storey and attic character farmhouse style cottage, with side sunroom projection, various size/style outbuildings, and large detached tractor shed, set on just under 4 acres of associated grounds.

3.0 CONSTRUCTION

The outer walls are predominately of a solid stone design.

Roofs are predominately pitched, timber framed and overlaid in slate.

4.0 ACCOMMODATION

Ground floor - entrance vestibule, hallway/stairs, lounge, sitting room, bedroom, breakfasting kitchen, sunroom, inner hallway, study/home office, utility area and shower room with WC.

Upper floor - landing, two bedrooms and bathroom with WC.

5.0	SERVICES (No tests have been applied to any of the services)						
Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Private septic tank understood to be contained within associated grounds.
Central Heating:		Gas fired to steel radiators.					
6.0	OUTBUILDINGS						
Garage:		Large detached steel portal framed tractor shed.					
Others:		Series of detached and attached stores and workshop style structures exist.					
7.0	<p>GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i></p>						

In general terms the subjects have been adequately maintained with regard to age and style. Points noted are considered commensurate with a property of this age and type capable of remedy in the course of routine maintenance.

General weathering and wear and tear noted throughout external building fabric, which will require routine maintenance expenditures, increasing over time.

Some above average moisture readings were obtained to lower wall linings at ground floor level and around half landing window.

Localised positive moisture readings were obtained within rear single storey office/study area. Investigate and repair as necessary.

Thereafter, a number of scattered woodworm bore holes were noted to joinery items, predominately within first floor cupboards and under stair store cupboard. In the absence of valid guarantees for past treatments, further advice should be obtained via a reputable timber and damp specialist.

Scattered woodworm bore holes also appear to exist within main attic space.

In light of the above points, it would be prudent to obtain further advice via a reputable timber and damp specialist.

Mixed age/style external structures were noted.

The large tractor shed displays a degree of wear and tear and localised impact damage to steel linings. The attached metal storage unit displays defect and evidence of water ingress. Therefore repairs are required.

The detached workshop/office structure displays high levels of wear and tear, and in addition decay and positive moisture readings were noted and obtained to roof joists.

The roof structure displays high levels of wear and tear and localised damage. Repairs are required as a priority. Asbestos components should only be handled by licensed contractors.

Again positive moisture readings were obtained internally. Advice should be obtained via a reputable timber and damp specialist.

An open to air structure was noted, which has suffered storm damage in recent times. Comprehensive repair is required.

Thereafter structures display high levels of wear and tear to external fabric, and moisture readings were obtained throughout.

Grounds were found to be in mixed style/condition, with neat and tidy grounds to front and side.

Frost damage was noted to some hard standings.

Decay noted to a timber free standing open to air structure, which requires repair.

General wear and tear noted to boundaries and hard standings thereafter.

Routine maintenance expenditures should be anticipated.

Some surface water was noted, and it would be prudent to confirm that drainage arrangements are satisfactory.

Some field ditches were noted, however, we have not inspected these areas. Potential purchasers should conduct background enquiries in this regard.

Again, we have not inspected the entirety of the plot/associated grounds.

8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>
------------	--

Some above average moisture readings were obtained to lower wall linings at ground floor level.

Localised positive moisture readings were obtained within rear single storey office/study area. Investigate and repair as necessary.

Thereafter, a number of scattered woodworm bore holes were noted to joinery items, predominately within first floor cupboards and under stair store cupboard. In the absence of valid guarantees for past treatments, further advice should be obtained via a reputable timber and damp specialist.

Scattered woodworm bore holes also appear to exist within main attic space.

In light of the above points, it would be prudent to obtain further advice via a reputable timber and damp specialist.

Mixed age/style external structures were noted.

The large tractor shed displays a degree of wear and tear and localised impact damage to steel linings. The attached metal storage unit displays defect and evidence of water ingress. Therefore repairs are required.

The detached workshop/office structure displays high levels of wear and tear, and in addition decay and positive moisture readings were noted and obtained to roof joists.

The roof structure displays high levels of wear and tear and localised damage. Repairs are required as a priority. Asbestos components should only be handled by licensed contractors.

Again positive moisture readings were obtained internally. Advice should be obtained via a reputable timber and damp specialist.

An open to air structure was noted, which has suffered storm damage in recent times. Comprehensive repair is required.

Thereafter structures display high levels of wear and tear to external fabric, and moisture readings were obtained throughout.

8.1 Retention recommended:	Subject to estimates. We have aimed to reflect the general condition of the property and associated outbuildings within our opinion of value, however, we reserve the right to amend our valuation figure upon sight of specialist reports and cost estimates.
-----------------------------------	--

9.0	ROADS & FOOTPATHS
------------	------------------------------

Made up and assumed adopted at public highway, with private access roadway thereafter.

10.0	BUILDINGS INSURANCE (£):	820,000 (guide figure for basic reconstruction). Given the size, number and style of outbuilding/structures, it would be prudent to obtain specialist advice in the regard to ensure comprehensive coverage exists.	GROSS EXTERNAL FLOOR AREA	209 (including sunroom but excluding outbuildings).	Square metres
-------------	---------------------------------	---	----------------------------------	---	----------------------

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.

11.0	GENERAL REMARKS
-------------	------------------------

The property and surrounding plot have been subject to various alterations and extensions to form current layout and footprint. It should therefore be confirmed that all necessary Local Authority permissions and consents were obtained at the relevant dates.

A side sunroom/conservatory projection has been formed at some stage.

Furthermore a dormer projection has been formed at roof level over bathroom.

It should be confirmed that necessary Local Authority permissions, warrants and consents were obtained at the appropriate dates.

Confirm the exact extent of boundaries, acreage and rights of way by reference to Title Deeds.

Potential purchasers should conduct their own enquiries with regard to usage and permissions pertaining to tractor shed and external store/outbuildings.

Enquiries should be made with regard to drainage arrangements and any flood events that may historically have affected surrounding land. It should be confirmed that building and contents insurance can be obtained on standard terms.

It should be confirmed that necessary permissions were obtained for the construction of a large tractor shed.

The subjects are situated within an area of known past coal mining activity, and as such a Coal Mining Report should be obtained prior to purchase.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	430,000	FOUR HUNDRED AND THIRTY THOUSAND POUNDS.
12.2	Market Value on completion of essential works (£):	-	
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	26/08/2024	
Signature:		Electronically Signed: 267237-7e8020c8-175a	
Surveyor:	Nick Davis	MSc MRICS	Date: 26/08/2024
Kilmarnock - Allied Surveyors Scotland Ltd			
Office:	91 John Finnie Street Kilmarnock KA1 1BG	Tel: 01563 572 341 Fax: email:	kilmarnock@alliedsurveyorsscotland.com

PART 3.

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Holmes Cottage Galston Road Hurlford, Kilmarnock KA1 5JD
-------------------------	---

Customer	Mrs. J Shuttleton
-----------------	-------------------

Customer address	Holmes Cottage Galston Road Hurlford, Kilmarnock KA1 5JD
-------------------------	---

Prepared by	Nick Davis, MSc MRICS Kilmarnock - Allied Surveyors Scotland Ltd
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

HOLMES COTTAGE, HOLMES, GALSTON, KA1 5JD

Dwelling type: Detached house
Date of assessment: 26 August 2024
Date of certificate: 26 August 2024
Total floor area: 187 m²
Primary Energy Indicator: 293 kWh/m²/year


Reference number: 7314-3828-3630-2286-2222
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£11,010	See your recommendations report for more information
Over 3 years you could save*	£4,086	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

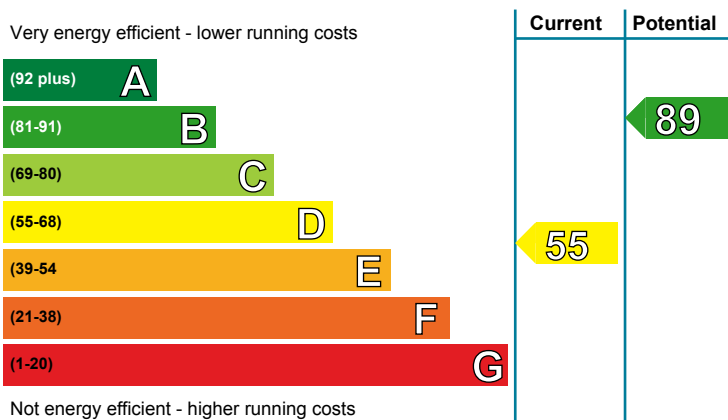


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (55)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

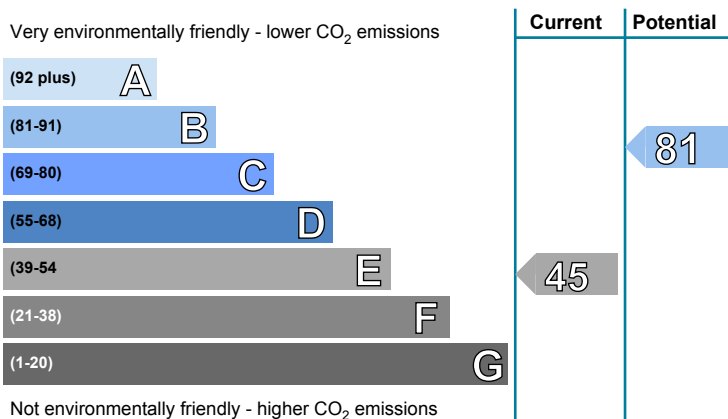

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£1494.00
2 Internal or external wall insulation	£4,000 - £14,000	£1518.00
3 Floor insulation (suspended floor)	£800 - £1,200	£594.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Pitched, 25 mm loft insulation	★★☆☆☆	★★☆☆☆
	Roof room(s), ceiling insulated	★★☆☆☆	★★☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
	Solid, insulated (assumed)	—	—
Windows	Mostly double glazing	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 68% of fixed outlets	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 53 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 9.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 6.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.






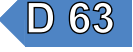



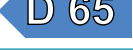



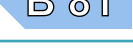
Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,843 over 3 years	£5,916 over 3 years	
Hot water	£501 over 3 years	£501 over 3 years	
Lighting	£666 over 3 years	£507 over 3 years	
Totals	£11,010	£6,924	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£498		
2 Internal or external wall insulation	£4,000 - £14,000	£506		
3 Floor insulation (suspended floor)	£800 - £1,200	£198		
4 Low energy lighting for all fixed outlets	£30	£45		
5 Replacement glazing units	£1,000 - £1,400	£114		
6 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£491		
7 Wind turbine	£15,000 - £25,000	£1025		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

5 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

7 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	35,553	(3,798)	N/A	(5,577)
Water heating (kWh per year)	2,018			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Nicholas Davis
Assessor membership number:	EES/022444
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	91 John Finnie Street Kilmarnock KA1 1BG
Phone number:	01563 572341
Email address:	kilmarnock@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

Holmes Cottage
Galston Road
Hurlford, Kilmarnock
KA1 5JD

Seller(s)

J Shuttleton

Completion date of property questionnaire

21/08/2024

Note for sellers

1.	Length of ownership
	<p>How long have you owned the property?</p> <p>5 years 10 months</p>
2.	Council tax
	<p>Which Council Tax band is your property in? (Please circle)</p> <p><input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input checked="" type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H</p>
3.	Parking
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input checked="" type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input checked="" type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify): Private land / Yard</p>

property questionnaire

4. Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
5. Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
6. Alterations/additions/extensions		
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7. Central heating		
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial

property questionnaire

	<p>If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><i>Mains Gas Boiler and Wood Burning Stove</i></p>	
	If you have answered yes, please answer the three questions below:	
	<p>(i) When was your central heating system or partial central heating system installed?</p> <p><i>Gas boiler 5 years ago wood stove 3 years ago</i></p>	
	(ii) Do you have a maintenance contract for the central heating system?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	<p>If you have answered yes, please give details of the company with which you have a maintenance contract</p> <p><i>D M Plumbing</i></p>	
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> <p><i>28.9.23</i></p>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Scottishpower
	Water mains or private water supply	Y	Water Mains
	Electricity	Y	Scottish Power
	Mains drainage	Y	Septic tank
	Telephone	Y	Mobile
	Cable TV or satellite	Y	BT/ Sky Dish
Broadband	Y	EE	
b	Is there a septic tank system at your property?		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: <i>No Neighbours</i>		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

property questionnaire

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
12. Charges associated with your property		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13. Specialist works		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

property questionnaire

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15. Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16. Notices that affect your property		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Janice Shuttleton
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	21/08/2024